



PIPE REAMING, RESTRAINED JOINT PVC PIPE HELPS COLORADO MUNICIPALITY COMPLETE CHALLENGING SEWER LINE REPLACEMENT

Application:
Pipe Reaming

Project Type:
Sanitary Sewer

Owner:
City of Fort Collins

Product Used:
12" Certa-Flo® PVC Pipe

General Contractor:
Connell Resources Inc

Sub-Contractor – Pipe Reaming:
Temple Construction
Company LLC

Engineer:
Stantec Consulting Engineers

The City of Fort Collins had 4,000 feet of aging vitrified clay sanitary sewer line that was often in need of maintenance and caused many other headaches for the municipality. The pipe had several cracks and offset joints, the old brick manholes were deteriorating and the line was undersized for accommodating the city's growing needs in the area of town it served. Additionally, the redevelopment of the district over the years made maintenance access to the sewer line very difficult, with a portion of the pipeline now within 10 feet of residential homes and directly below 6 commercial buildings and 10 mobile homes.

CHALLENGE

By working with their design team, Stantec, the utilities department began developing a plan for a rehabilitated sewer line that would adequately convey current and future flow rates. The engineer also made attempts to find the best route for relaying the sewer to a corridor that would allow better access for city maintenance workers.



“The original sewer main’s accessibility was just awful – most of the manholes were in places that you just couldn’t get to,” says Dean Saye, project manager for the city of Fort Collins Utilities. “To improve access during the pipe replacement, we had the option of rerouting the line or keeping it in place and making improvements to it.”

The existing sewer had relatively minimum grades of 0.20 percent and 0.40 percent. With these minimal slopes, re-routing the sewer line would mean extending existing sanitary sewer services and purchasing a new permanent easement. Reviewing the options, the shallow slopes combined with the re-routing costs led the design team to determine that it was not feasible to re-route the sewer line to a more accessible alignment. The new line would need to follow the old route.

APPLICATION

Together, the team worked to figure out the least disruptive way to replace the failing sewer line. The majority of the 4,000 feet



MUNICIPAL CASE STUDY

could be replaced through an open trench, but the 1,600-foot portion running under the business district required a trenchless method that would allow the new line to follow the same path as the existing line. Several trenchless methods were explored eventually narrowing the choices down to two – static pipe bursting and pipe reaming. Pipe reaming was recommended by a contractor the city had previously worked with and, due to the obstacles presented by the project, it soon emerged as the frontrunner.

“Pipe reaming was the more feasible choice, due to some concerns we had about pipe bursting in this application,” Saye explains. “The commercial buildings were cinder-block construction and we were worried that bursting might produce strong enough tremors to crack or crumble their walls. We knew that reaming would work better in this situation.”



Pipe reaming is similar to static pipe bursting in that the host pipe is split by a cutting head, however, the pipe fragments are removed to allow the new pipe to be pulled into the same location as the old pipe. Pipe bursting disperses the host pipe fragments out into the surrounding soil. In pipe reaming applications, the fragments are ground more finely and mixed with bentonite drilling fluid to create a slurry which is evacuated through the manholes. The resulting pressure relief prevents any damage to nearby fragile structures or surface paving during the installation process. As for pipe material, the city preferred restrained joint PVC since it was already prevalent in the Fort Collins water and sewer infrastructure. Temple Construction’s recommendation of 12-inch Certa-Flo®, a high-strength integral-bell PVC pipe with the Certa-Lok® restrained joint system, was accepted.

SOLUTION

Connell Resources subcontracted the pipe reaming to Temple Construction Company LLC of Fort Collins, which licensed the InneReam pipe replacement system from Nowak Pipe Reaming Inc., for the job. The plan was to upsize the sewer line from its initial mix of 8- and 10-inch diameter pipe to a uniform 12-inch diameter to provide better sewer service to the growing neighborhood. Certa-Flo PVC pipe, from NAPCO Pipe & Fittings, is available in 10- and 20-foot lengths allowing for smaller and more economically constructed pit sizes and its light green color also makes it easier to see during camera inspection of sewers.



“We had to use shorter joints and the pipe couldn’t be something fusible,” Saye said. “We liked the option of 10-foot pipe joints because we really didn’t have any more room than that available for stacking them.”

The project launched and work began in August 2011. The reaming process was expertly coordinated to produce seamless pipe installations and minimize sewer service downtime for customers. The pipe reaming was broken up into sections depending on space availability along the line and, often, an open trench run would follow a reamed section. One small section running under a railroad crossing required a pneumatic hammer. After the businesses on the block closed for the day, Connell Resources’ crew, ranging from 15 to 18 workers, disconnected the sewer services of customers along the section to be reamed, removed the downstream and upstream manholes and set up a sewer bypass to continue service. Then, they dug 30-foot long entry and exit pits for the pipe reaming equipment so that Temple Construction could come in early the next morning and get right to work. Throughout the project, the Connell Resources crew used a variety of excavators. John Deere 50D and 60D mini excavators were also used for dirt removal.

Working with a crew of five, Temple Construction, per InneReam specs, used a Vermeer 24x40 horizontal directional drill, with a 14-inch carbide-toothed conical reaming head. Three crewmembers worked the drill and monitored sewer line grade while

two members assembled pipe in the pits. Bores were made approximately 5 feet below surface through clay soil, with slight cobble, to reach the old clay host pipe, which was ground into slurry as the bore moved forward. The removal minimized hydraulic pressure ahead of the drill head.


“We were concerned about what would happen with the pipe fragments and other debris picked up during the ream – if we’d had a service ahead of us that wasn’t disconnected, all of that could have gone into the sewer system and clogged it up.” Temple said. “Fortunately, all of the slurry was evacuated through the manholes, so we had no problems. And, we were impressed with how well the reamer ground up the old clay pipe. When we dumped the first couple of loads from the vac truck, there weren’t any pipe fragments bigger than a penny left in the slurry.”



At the end of each ream, the crew attached the joints of 12-inch Certa-Flo pipe onto the drill head and the pipe string was pulled into place. The crew easily assembled the pipe, adding joint after joint as the pullback process continued. The crew used 10-foot joints in the more constricted sections and 20-foot joints elsewhere.

“We liked the integral bell on the Certa-Flo pipe, which saved us a spline in each assembly, as well as having the option of both 10-foot and 20-foot joints,” Temple says. “It was easy to assemble and held together really well during the pulls.”

The restrained joint PVC pipe was installed to meet a tight-tolerance grade of 0.39 percent and the reaming corrected any pre-existing grade problems. Due to excellent preparation and coordination, the pipe reamings and pullbacks went smoothly and were usually done within 4 hours each day. When the camera inspections of the new sewer line sections were completed, Connell Resources’ crew then reconnected services and filled-in excavations, finishing by the end of the work day. Together, the 1,600-feet of pipe reaming and 2,400-feet of open-trench pipe were finished in December 2011.

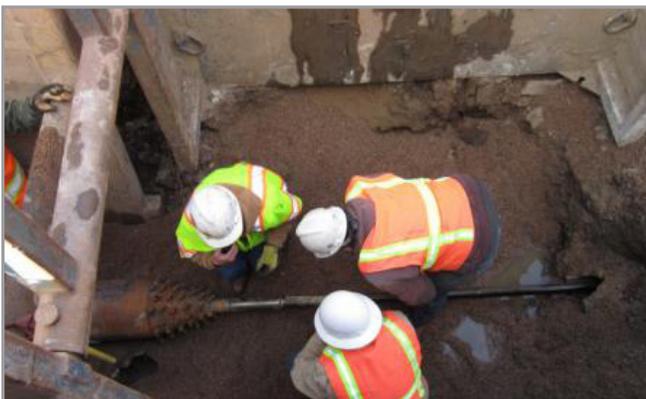

The city received very positive feedback from the homeowners and business owners throughout the district. The project produced only minimal disruption and caused no harm to the commercial buildings or homes.

“At the inception of this project, we started talking to people in the neighborhood about it and made sure to keep them extremely well-informed at each step,” Saye noted. “They were, in general, very appreciative with what we were doing, since they were getting better sewer service than they’d had for several years. The project didn’t interfere with them at all and they barely saw anything.”

As for the pipe reaming choice, Saye says it provided an excellent solution to a challenging pipe replacement, but one that could be cost-prohibitive in less-challenging projects.

“We got exactly what we needed out of it - we didn’t tear up any walls or crack slabs – but pipe reaming is not cheap to do,” Saye explained. “We paid a premium, but in this case, it was worth it. All we had to do was crack a wall of a nearby building, and our project would have become a lot more expensive. The project was a success.”

